

Horizontal ABSOLUTE Scale Diameter Function




- The ZERO point is set only once and is stored as the ABSOLUTE ZERO point until the next battery replacement
- You can make the highest precision measurements even at the highest drive speed.




572-483-10

Metric Horizontal multi-function type with diameter displaying function

No.	Range [mm]	Accuracy	G [mm]	L1 [mm]	L2 [mm]	H [mm]	t [mm]	Mass [g]
572-480-10	0 - 100	0,03 mm		244	220			250
572-481-10	0 - 150	0,03 mm		294	270			280
572-482-10	0 - 200	0,03 mm		344	320			310
572-483-10	0 - 300	0,04 mm		444	420			370
572-484-10	0 - 450	0,04 mm	23,2	594	570	14,6	6	760
572-485-10	0 - 600	0,05 mm	23,2	774	750	14,6	6	900
572-486-10	0 - 800	0,06 mm	27,2	974	950	18,6	10	1710
572-487-10	0 - 1000	0,07 mm	27,2	1.174	1.150	17,8	10	2040

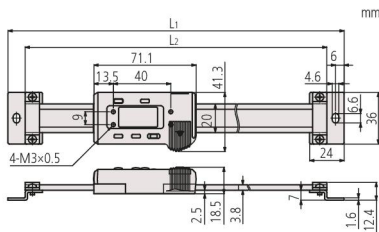

100-300 mm

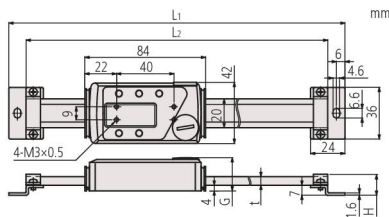

450-1000 mm

Functions	
ON/OFF	
DATA (output with cable) / HOLD (display value)	
Low voltage alarm	
Data output	
ZERO SET	
PRESET	
Diameter function	
ORIGIN	

Specifications

Digital step	0,01 mm
Max response speed	Unlimited

Optional accessories

No.	Description
905338	Digimatic Cable, Flat Straight Type, 1m
905409	Digimatic Cable, Flat Straight Type, 2m
905689	Digimatic Cable, Flat L-Shape Type, 1m
905690	Digimatic Cable, Flat L-Shape Type, 2m
905691	Digimatic Cable, Flat L-Shape Right Type, 1m
905692	Digimatic Cable, Flat L-Shape Right Type, 2m
905693	Digimatic Cable, Flat L-Shape Left Type, 1m
905694	Digimatic Cable, Flat L-Shape Left Type, 2m
06AFM380C	USB Input Tool Direct (Digimatic USB), Digi/Digi2, Straight, with Data Button
02AZD790C	U-WAVE-T Connection Cable C, Straight, with Data Button

Consumable spares

No.	Description
938882	Battery SR44 1.5V